
Scale: N.T.S.



NOTES:

- 1. CLEAN METAL AND MEMBRANE WITH EVERGUARD® TPO SEAM CLEANER OR EVERGUARD® CLEANWELD™ CONDITIONER AND ALLOW TO DRY.
- 2. PRIME TOP OF FLASHING WITH TPO PRIMER OR LOW VOC TPO PRIMER.
- 3. DO NOT SPILL PRIMER ON HEAT WELDED SEAM AREA.
- 4. DO NOT OVERLAP ENDS OF FLASHING WITH FLASHING STRIP.
- 5. HEAT WELD THE COVER TAPE (NON-ADHESIVE SIDE ONLY) TO THE MEMBRANE AREA USING A 1-1/2" [38.1 mm] WELD WITH MACHINE AUTOMATIC WELDER.
- 6. CONTACT GAF FOR APPROPRIATE RECOMMENDATIONS NEEDED FOR ANSI/SPRI/FM4435/ES-1 DESIGN CRITERIA.



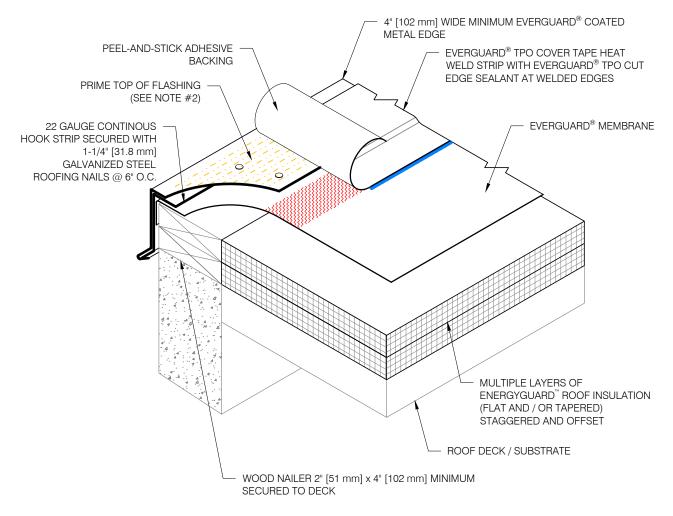

Email: technical@gaf.nz Call: 0800 42 33 55

Web: www.gafroofing.co.nz/TPO
GAF New Zealand Distributor

Drawing Title: GAF EverGuard TPO Roofing		
REF:	Date:	Version:
T-918	17/01/2025	Α